

1550nm 1x2 2x2 Broadband PM Fiber Fused Coupler

1550nm 1x2, 2x2 Broadband Polarization Maintaining (PM) Fused Coupler is built with fused biconical taper (FBT) technology, it can be used in split the optical signal power into two parts with even or various coupling ratio and keep the polarization maintaining, it's widely applied in fiber optic sensor, fiber amplifier system and fiber optic diffraction field.

Application:

Fiber Optic Amplifier
Fiber Optic Sensor
Fiber Laser
Optical Diffraction System

Features:

Low Excess Loss
Low Insertion Loss
High Extinction Ratio
High Reliability



Specification:


Parameter		Symbol	Value	Unit
Center Wavelength		λ	1550	nm
Bandwidth		BW	± 50	nm
Max. Excess Loss		EL	0.8	dB
Max. Insertion Loss	50/50 (± 3.5)	IL	3.8/3.8	dB
	40/60 (± 2.5)		5.2/3.1	dB
	30/70 (± 2.5)		5.8/2.0	dB
	20/80 (± 2.0)		8.0/1.5	dB
	10/90 (± 1.2)		11.6/1.2	dB
	5/95 (± 0.8)		14.8/0.8	dB
	3/97 (± 0.7)		17.0/0.5	dB
	2/98 (± 0.6)		18.4/0.4	dB
Min. Extinction Ratio	For Ratio > 10% Port	ER	20	dB
	For 5% \leq Ratio \leq 10% Port		18	dB
	For Ratio < 5% Port		16	dB
Min. Directivity			50	dB
Min. Return Loss		RL	50	dB
Fiber Type			PM Panda Fiber	-
Max. Tensile Load			5	N
Max. Optical Power (CW)		P	2	W
Operating Temperature		T	-40~75	$^{\circ}\text{C}$
Storage Temperature		T	-40~85	$^{\circ}\text{C}$
Package Dimension			$\Phi 3.0 \times L54$	mm

Notice: Above specifications are tested at center wavelength without connector in room temperature @23 $^{\circ}\text{C}$.

For devices with connectors, IL will be 0.3dB higher, EL will be 0.2dB higher, ER will be 2dB lower, slow axis is default aligned to the connector key.

If need optical power more than 2W CW, please contact us to confirm. Connectors only 1W (Continue Wavelength) optical power guarantee.

Drawing:

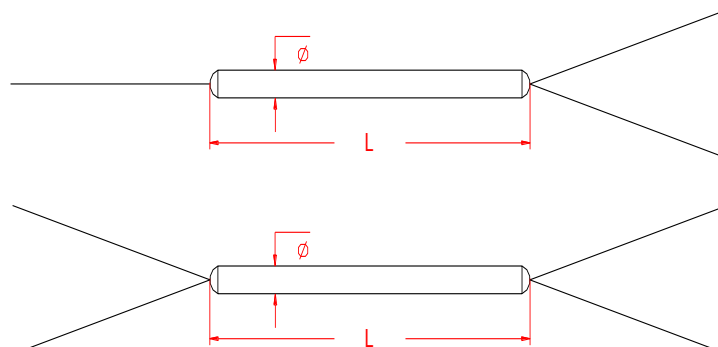

Ordering Information (Part Number):

BPMFUC-WWWW-PP-A-RR-J-LL-CC						
WWW	PP	A	RR	J	LL	CC
Wavelength	Port	Working Axis	Coupling Ratio	Fiber Jacket	Fiber Length	Connector
1310 - 1310nm	12 - 1x2 22 - 2x2	B - Both Axes Working S - Slow Axis Working F - Fast Axis Working	01 - 1/99 02 - 2/98 03 - 3/97 05 - 5/95 10 - 10/90 20 - 20/80 30 - 30/70 40 - 40/60 50 - 50/50 SS - Specify	B - 250um Bare Fiber 9 - 900um Loose Tube	05 - 0.5m 10 - 1.0m 15 - 1.5m 20 - 2.0m SS - Specify	NE - None FA - FC/APC FU - FC/UPC SA - SC/APC SU - SU/APC LA - LC/APC LU - LC/UPC SS - Specify