

## High Power 1550nm PM 3-port Optical Circulator

High Power 1550nm Polarization Maintaining (PM) 3-port Optical Circulator is a fiber passive component built with PM fiber, which can change signal light transmission path, the signal can be delivered from Port 1 to Port 2, the other signal light from Port 2 to Port 3, the high isolation can block the back reflection light. It's widely used in Laser System, Fiber Optic Sensor and Coherent Detecting field. The Optical Power can be up to 20W CW upon request.

### Application:

Fiber Optic Amplifier  
Fiber Optic Sensor  
Laser System  
Coherent Detecting

### Features:

High Power  
High Extinction Ratio  
High Isolation  
High Reliability



### Specification:


Parameter	Symbol	Value	Unit
Center Wavelength	$\lambda$	1550	nm
Bandwidth	BW	$\pm 30$	nm
Typ. Insertion Loss (Port 1 to 2, 2 to 3)	IL	0.7	dB
Max. Insertion Loss (Port 1 to 2, 2 to 3)	IL	1.0	dB
Typ. Isolation (Port 2 to 1, 3 to 2)	Iso	45	dB
Min. Isolation (Port 2 to 1, 3 to 2)	Iso	35	dB
Min. Extinction Ratio	ER	20	dB
Min. Cross Talk	Ct	50	dB
Min. Return Loss	RL	50	dB
Max. Optical Power (CW)	P	1, 3, 5, 10, 20 or specify	W
Max. Peak Power	P	5, 10 or specify	kW
Max. Tensile Load		5	N
Fiber Type		PM Panda fiber	-
Operating Temperature	T	-5~70	°C
Storage Temperature	T	-40~85	°C
Package Dimension		$\Phi 5.5 \times L50$ or $L80 \times W12 \times H10$	mm

Notice: Above specifications are tested at center wavelength without connector in room temperature @23°C.

For devices with connectors, IL will be 0.3dB higher, RL will be 5dB lower, ER will be 2dB lower.

Slow axis is default aligned to the connector key. Connectors only 1W CW optical power guarantee.

### Drawing:

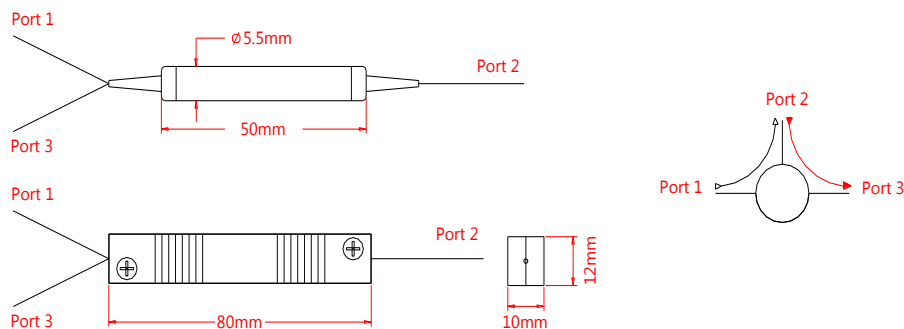

### Ordering Information (Part Number):

HPMCIR- <b>WWW</b> - <b>P</b> - <b>A</b> - <b>HH</b> - <b>J</b> - <b>LL</b> - <b>CC</b>						
<b>WWW</b>	<b>P</b>	<b>A</b>	<b>HH</b>	<b>J</b>	<b>LL</b>	<b>CC</b>
Wavelength	Port	Working Axis	Handling Power	Fiber Jacket	Fiber Length	Connector
1310 - 1310nm 1550 - 1550nm SSSS - Specify	3 - 3 Ports	F - Fast Axis Blocked Slow Axis Working B - Both Axes Working	01 - 1W 03 - 3W 05 - 5W 10 - 10W 15 - 15W 20 - 20W SS - Specify	B - 250um Bare Fiber 9 - 900um Loose Tube	05 - 0.5m 10 - 1.0m 15 - 1.5m 20 - 2.0m SS - Specify	NE - None FA - FC/APC FU - FC/UPC SA - SC/APC SU - SU/APC LA - LC/APC LU - LC/UPC SS - Specify